

- 1. Install body at the required level
- 2. If vapour barrier/secondary membrane is fitted at body level it may be dressed over the body flange and into the body such that it will be clamped by the extension clamp when fitted.
- 3. Fit extension clamp using 3 off M8 x 25 csk slotted screws ensuring that;
  - a. the neoprene gasket is fitted below clamp.
  - b. the fibre washers are fitted under the screw heads.
- 4. Fit extension flange into extension clamp. Adjust to required height and seal thread with a suitable sealant.
- 5. Extension flange is now ready to accept membrane / grating assembly.
- 6. Refer to membrane manufacturer's instructions and prepare flange with suitable primer.

  Apply membrane, dressing over flange sufficiently into sump of body to enable it to be clamped.

  Position membrane clamping collar and secure to body using appropriate supplied fixings, see below.

For membranes up to 15mm thick - use M8 x 30 Countersunk head screws (Wade Pt No 50902055) For membranes over 15mm thick - use M8 x 50 Countersunk head screws (Wade Pt No 50902059)

7. Fit grating to membrane clamping collar.

See also the general installation guidelines in Wade 'Roof Outlets' Brochure.

© 2011

ISS. No.			DRAWN	DC	15-2-11	TITLE		
C.N. No.			CHECKED			GENERAL INSTALLATION DETAIL FOR WC2xxE AND WC3xxE SERIES		
DATE			APPRVD.			ROOF OUTLETS		
WADE		Part Number				SCALE	DRG. No.	ISSUE No.
		50910012				NTS	INSTAL 14	5